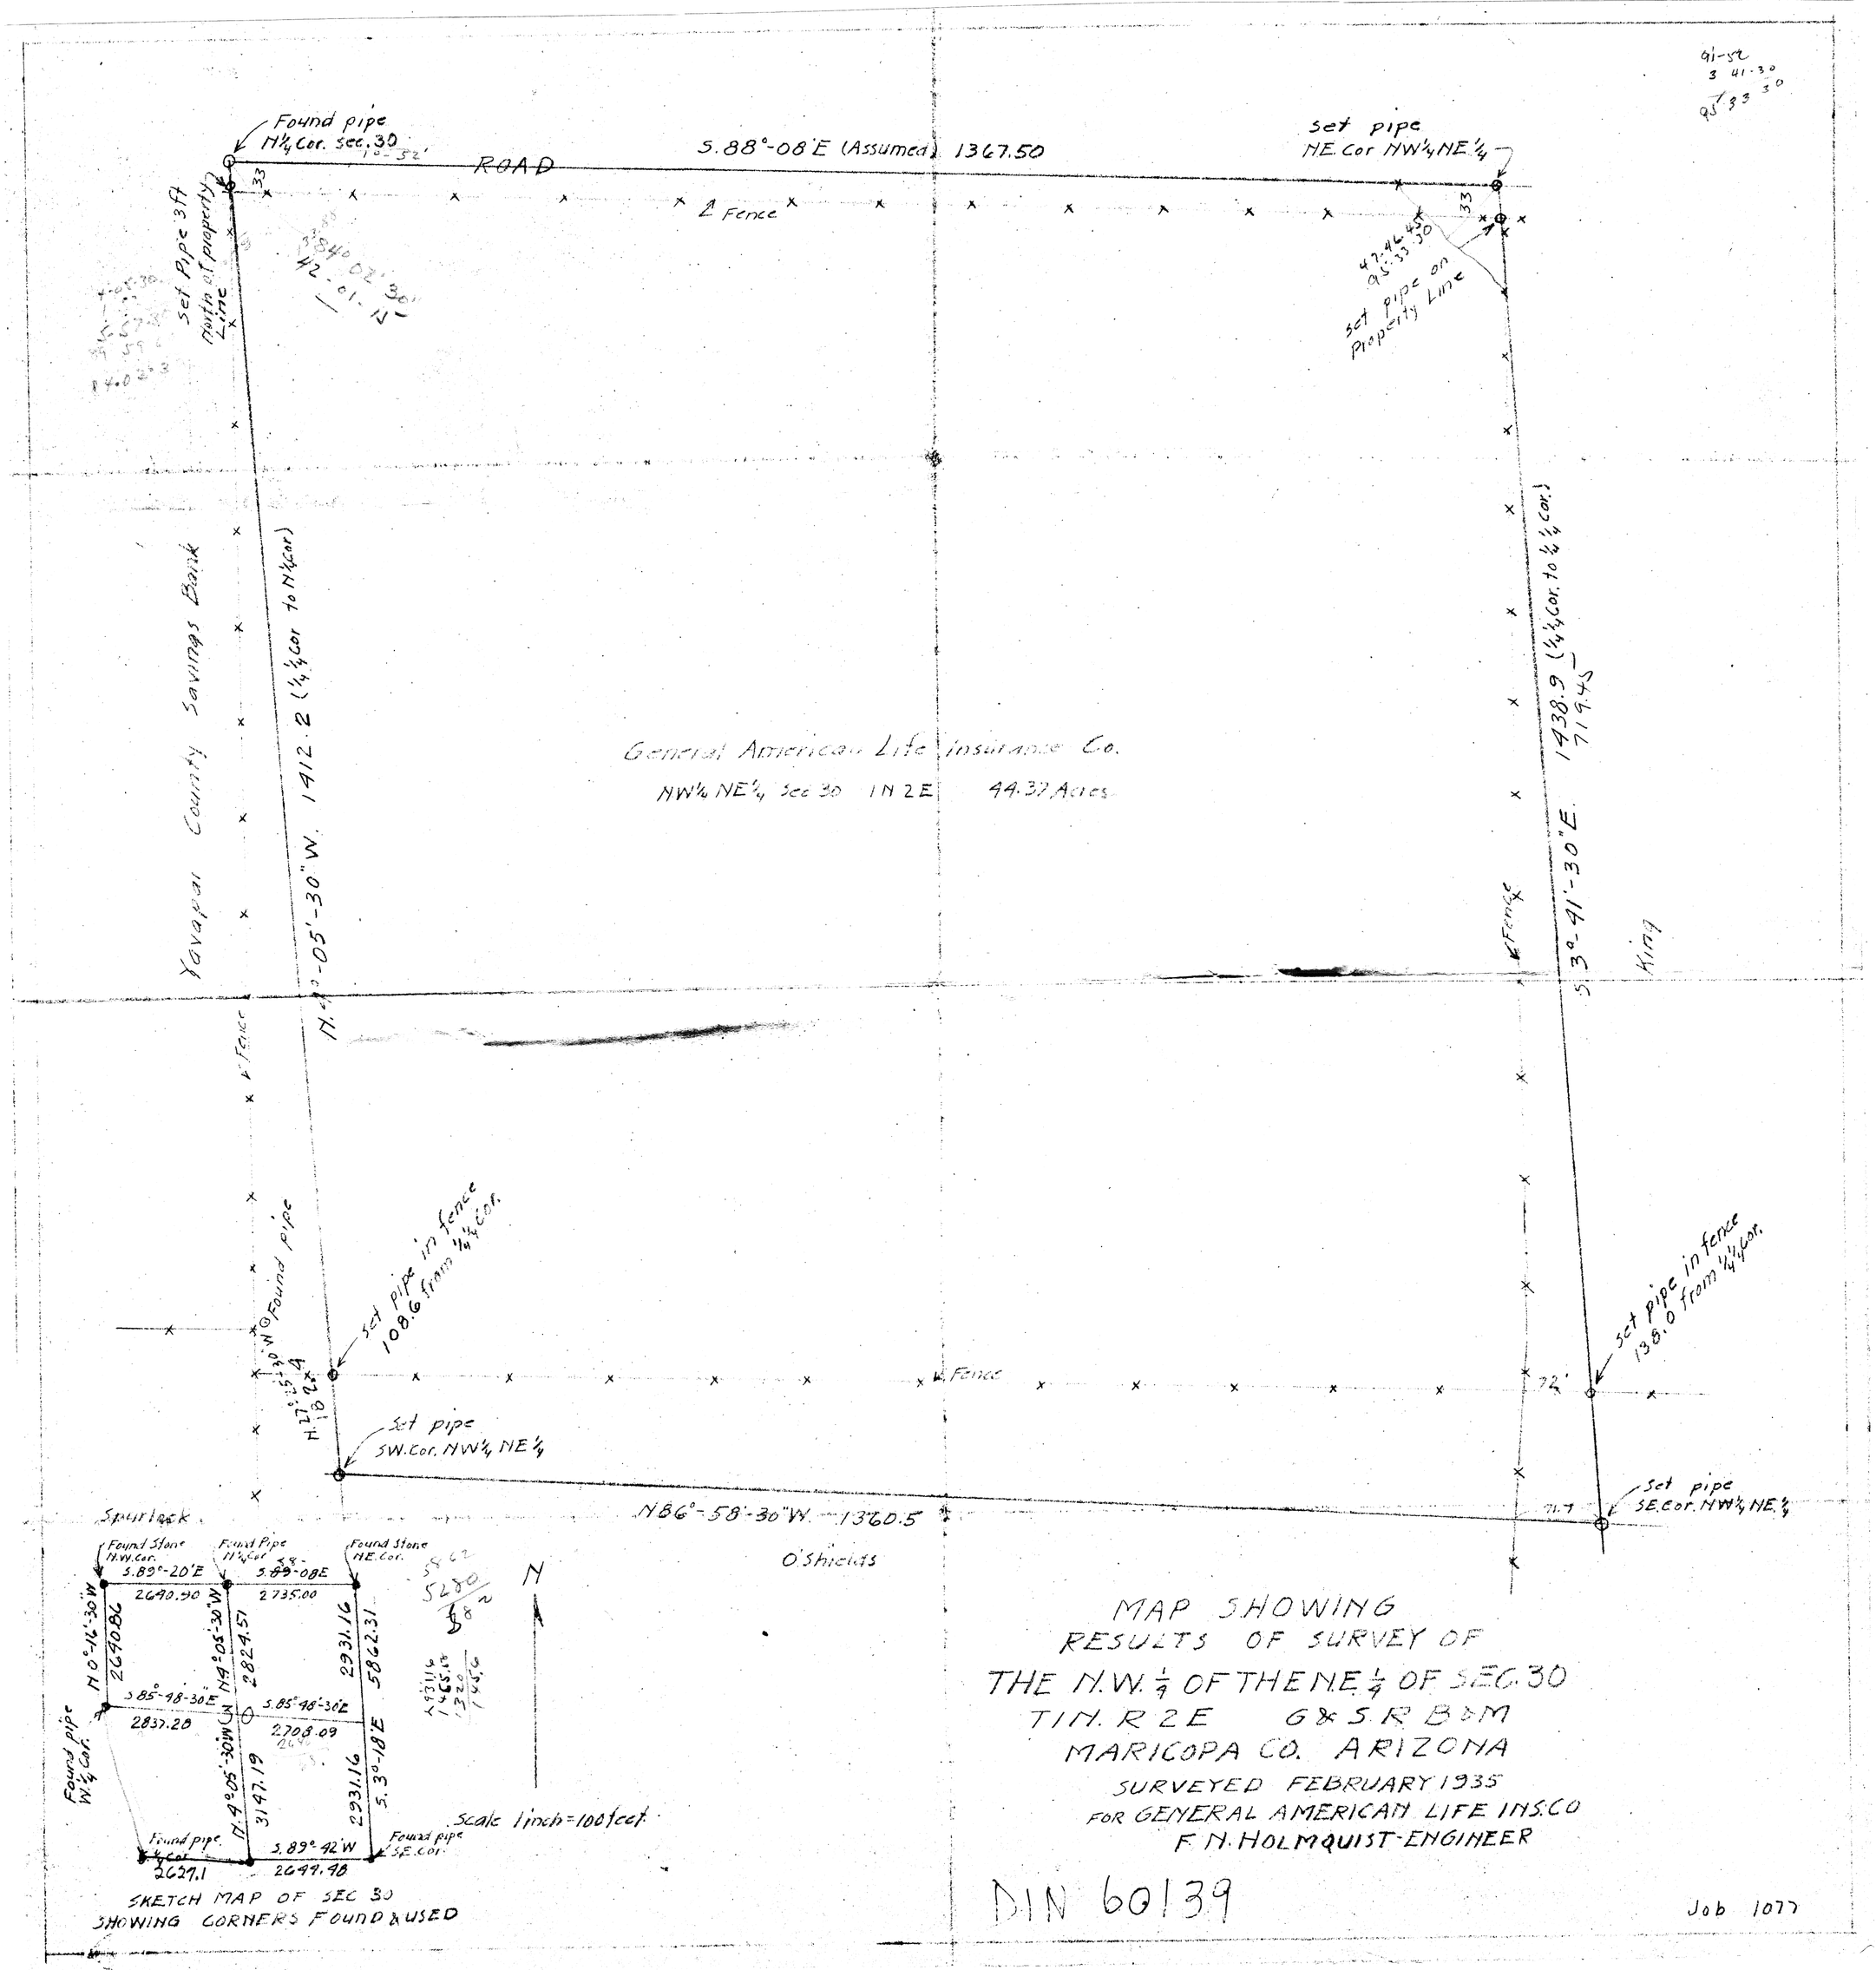
Found pipe
N¼ Cor. sec. 30
ROAD
S. 88°-08' E (Assumed) 1367.50
set pipe
NE. Cor NW¼ NE¼
Fence
Set Pipe 3 ft north of property Line
set pipe on Property Line
Yavapai County Savings Bank
N. 0°-05'-30" W. 1412.2 (¼ ¼ Cor to N¼ Cor)
General American Life Insurance Co.
NW¼ NE¼ Sec 30 1N 2E 44.37 Acres
S. 3°-41'-30" E. 1438.9 (¼ ¼ Cor. to ½ ¼ Cor.)
Fence
set pipe in fence 108.6 from ¼ ¼ cor.
set pipe in fence 138.0 from ¼ ¼ cor.
set pipe
SW. Cor. NW¼ NE¼
N86°-58'-30"W. 1360.5
O'Shields
set pipe
SE. Cor. NW¼ NE¼
Spur track
Found Stone N.W. Cor.
Found Pipe N¼ Cor
Found Stone NE. Cor.
S. 89°-20' E
S. 89°-08' E
2640.90
2735.00
N 0°-16'-30" W
2640.86
N. 0°-05'-30" W
2829.51
2931.16
5862.31
S. 85°-48'-30" E
S. 85°-48'-30" E
2837.28
2708.09
N. 0°-05'-30" W
3147.19
2931.16
S. 3°-18' E
Found pipe W¼ Cor.
Found pipe ¼ Cor
S. 89° 42' W
Found pipe SE. Cor.
2627.1
2649.98
Scale 1 inch = 100 feet
N
SKETCH MAP OF SEC 30
SHOWING CORNERS FOUND & USED
MAP SHOWING
RESULTS OF SURVEY OF
THE N.W. ¼ OF THE N.E. ¼ OF SEC. 30
T1N. R2E G & S.R B & M
MARICOPA CO. ARIZONA
SURVEYED FEBRUARY 1935
FOR GENERAL AMERICAN LIFE INS. CO
F. N. HOLMQUIST-ENGINEER
DIN 60139
Job 1077